

<b>Reference</b>	SSM34584
<b>Models</b>	Freelander 2 / L359
<b>Title</b>	(127,359946)Code P1889-74 Flagged `Traction Reduced`
<b>Category</b>	Driveability
<b>Last modified</b>	23-Jan-2008 00:00:00
<b>Symptom</b>	698298 Malfunction Indicator Lamp
<b>Attachments</b>	Haldex DTC Guide.pdf (Haldex DTC Guide.pdf)

**Content****Issue:**

If any vehicles are exhibiting concerns with a spurious message "Traction Reduced" and the code P1889-74 is flagged. Please check the integrity of the connections on the Pressure sensor on the Haldex unit, if there are no issues with the connectors then a replacement sensor will be required.

**Under no circumstance is the Haldex unit to be changed until a new Haldex sensor has been fitted to try and remedy the fault. To assist in diagnostics a breakdown of the DTC's has been attached, Where it refers to replace Haldex unit, these will be the subject of A WPAP or FRED submission.**

Vehicle will continue to operate correctly during the event.