

Reference SSM43699

Models Defender / L316

Title Defender Puma Diesel Turbo/
Intercooler hoses

Category Driveability

Last modified 15-Mar-2010 00:00:00

Symptom 614000 Lack/Loss of Power

Issue: A customer may report a loss of power when the engine is under load that may be accompanied by the illumination of the MIL lamp. In addition the following fault codes may be stored in the Powertrain Control module (PCM):

P0299-00 Turbocharger/ Supercharger
Underboost Condition

Content P006A-00 Mass Air Flow Correlation

Cause: The concern may occur due to an air leak on one of the Turbocharger or Intercooler hoses.

Action: Please ensure that the Turbocharger and Intercooler hoses are checked for any sign of degradation before continuing with further diagnosis and submit an ePQR with your findings.